


DIGITAL FORCE GAUGE



- Push and pull test
- Peak(max.) or tracking work mode
- Units: kgf, N, lbf
- Low and high limits with judgement
- Maximum 10 memories
- Automatic power off
- Overload alarm
- RS232C output
- Built-in rechargeable battery

accessory for type A

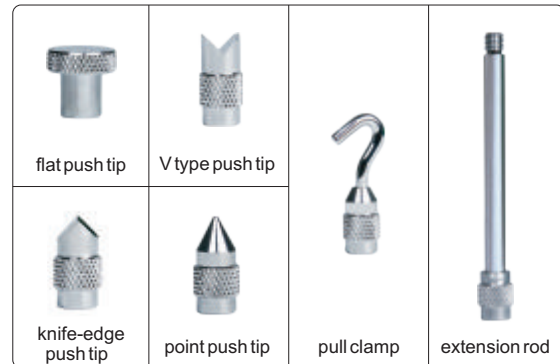

accessory for type B



SPECIFICATION

Code	ISF-DF10*	ISF-DF20*	ISF-DF50*	ISF-DF100*	ISF-DF200*	ISF-DF500*	ISF-DF1K*	ISF-DF2K*	ISF-DF5K*	ISF-DF10K*	ISF-DF20K*	ISF-DF50K*	ISF-DF100K*
Type	A(internal sensor)						B(external sensor)						
Load capacity	10N	20N	50N	100N	200N	500N	1KN	2KN	5KN	10KN	20KN	50KN	100KN
Resolution(N)	0.005	0.01	0.01	0.05	0.1	0.1	0.5	1	1	5	10	10	50
Measuring range	10% -100% full scale												
Accuracy	±0.5% full scale												

STANDARD DELIVERY

Code	ISF-DF10	ISF-DF20	ISF-DF50	ISF-DF100	ISF-DF200	ISF-DF500	ISF-DF1K	ISF-DF2K	ISF-DF5K	ISF-DF10K	ISF-DF20K	ISF-DF50K	ISF-DF100K
Main unit	1pc						1pc						
AC/DC adapter	1pc						1pc						
Push/Pull accessory	6pcs (flat push tip, V type push tip, knife-edge push tip, point push tip, pull clamp, extension rod)						4pcs (flat push tip, adapter, pull clamps)						

OPTIONAL ACCESSORY

RS232 cable and software ISF-DF-CABLE

*Add suffix on code No. to devote AC voltage and plug (refer to page V1)